

# ALUMINCO S.A.

## TEST REPORT

**SCOPE OF WORK**

STRUCTURAL PERFORMANCE TESTING ON *CRYSTALLINE L-LINE SIDE MOUNT F85-1B64* GLASS  
BALUSTRADE SYSTEM

**REPORT NUMBER**

I0411.03-119-19-R0

**TEST DATE(S)**

12/13/17 - 01/25/18

**ISSUE DATE**

03/19/18

**RECORD RETENTION END DATE**


01/25/22

**PAGES**

12

**DOCUMENT CONTROL NUMBER**

ATI 00642 (07/26/17)  
RT-R-AMER-Test-2846  
© 2017 INTERTEK

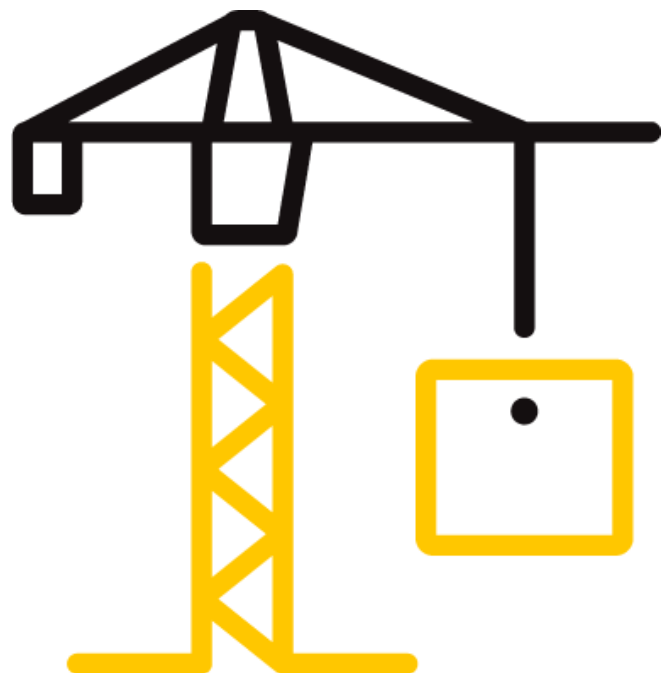

## TEST REPORT FOR ALUMINCO S.A.

Report No.: I0411.03-119-19-R0

Date: 03/19/18

### REPORT ISSUED TO

#### ALUMINCO S.A. ENGINEERING DIVISION

Inofita

Viotia, 32011

Greece

### SECTION 1

#### SCOPE

Intertek Building & Construction (B&C) was contracted by Aluminco S.A., Greece to perform structural performance testing in accordance with the 2015 IBC on their *Crystalline L-Line Side Mount F85-1B64* glass balustrade system. The system was evaluated for the design load requirements noted within Section 1607.8.1 and the safety factor requirements noted within Section 2407.1.1 of the 2015 International Building Code®, International Code Council.

Testing was conducted at the Intertek B&C test facility in York, PA. Intertek B&C has demonstrated compliance with ISO/IEC International Standard 17025 and is consequently accredited as a Testing Laboratory (TL-144) by International Accreditation Service, Inc. (IAS). This report does not constitute certification of this product nor an opinion or endorsement by this laboratory.

For INTERTEK B&C:

<b>COMPLETED BY:</b>	Emily C. Riley
<b>TITLE:</b>	Project Manager
<b>SIGNATURE:</b>	
<b>DATE:</b>	03/19/18

<b>REVIEWED BY:</b>	V. Thomas Mickley, Jr., P.E.
<b>TITLE:</b>	Senior Staff Engineer
<b>SIGNATURE:</b>	
<b>DATE:</b>	03/19/18

ECR/vtm:aaa

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample(s) tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.

## TEST REPORT FOR ALUMINCO S.A.

Report No.: I0411.03-119-19-R0

Date: 03/19/18

### SECTION 2

#### TEST METHOD(S)

The specimen was evaluated in accordance with the following:

**2015**, *International Building Code*<sup>®</sup>, International Code Council

**2015**, *International Residential Code*<sup>®</sup>, International Code Council

Structural tests were performed according to Chapter 17 (Structural Tests and Special Inspections) of IBC 2015.

#### Limitations

All tests performed were to evaluate structural performance of the guardrail assembly to carry and transfer imposed loads to the supporting structure. The specimen(s) were evaluated in accordance with the 2015 IBC performance requirements for use in configurations with three or more panels. For use in less than 3-Panel configurations, additional testing would be required. The test specimens evaluated included the glass panels and mounting shoes. Anchorage of the mounting shoes to the supporting structure is not included in the scope of this testing and would need to be evaluated separately.

### SECTION 3

#### MATERIAL SOURCE/INSTALLATION

All materials utilized for testing reported herein were provided to Intertek B&C by Aluminco, S.A. and were not sampled or selected by an independent inspection agency.

Test samples were provided by the client. Representative samples of the test specimen(s) will be retained by Intertek B&C for a minimum of four years from the test completion date.

Test specimens were inspected prior to testing to verify the condition of the materials was suitable for testing. No potentially compromising defects were observed.

### SECTION 4

#### EQUIPMENT

The glass balustrade system was tested in a self-contained structural frame designed to accommodate anchorage of the base rail assembly to steel mounting and application of the required test loads. The specimens were loaded using a hydraulic actuator attached to a forklift. Applied load was measured using an electronic load cell located in-line with the loading system. Electronic linear motion transducers were used to measure deflections.

## TEST REPORT FOR ALUMINCO S.A.

Report No.: I0411.03-119-19-R0

Date: 03/19/18

### SECTION 5

#### LIST OF OFFICIAL OBSERVERS

NAME	COMPANY
Christos Palaiologos	Aluminco S.A.
Michail Gerantzopoulos	Aluminco S.A.
Adam Schrum	Intertek B&C
Alva R. Baker	Intertek B&C

### SECTION 6

#### TEST PROCEDURE

Each test specimen was inspected prior to testing to verify size and general condition of the materials, assembly, and installation. No potentially compromising defects were observed prior to testing.

The balustrade assembly was installed and tested as a single panel section by directly securing (surface-mounting) the mounting shoe to a rigid steel test frame. The balustrade was assembled by representatives of Aluminco, S.A. Transducers mounted to an independent reference frame were located to record movement of reference points on the guardrail system components at the point of load application. See photographs in Section 10 for test setups.

An initial load, not exceeding 50% of design load, was applied and transducers were zeroed. Load was then applied at a steady uniform rate until reaching 2.0 times design load. After reaching 2.0 times design load, the load was released. After allowing a minimum period of one minute for stabilization, load was reapplied to the initial load level used at the start of the loading procedure, and deflections were recorded and used to analyze recovery. Load was then increased at a steady uniform rate until reaching 4.0 times design load or until failure occurred. The testing time was continually recorded from the application of initial test load until the ultimate test load was reached. All loads were applied from the interior side of the balustrade unless otherwise specified.

Deflection and permanent set were component deflections relative to their end-points; they were not overall system displacements. All loads and displacement measurements were horizontal, unless noted otherwise.

**TEST REPORT FOR ALUMINCO S.A.**

Report No.: I0411.03-119-19-R0

Date: 03/19/18

**SECTION 7**

**TEST SPECIMEN DESCRIPTION**

The *Crystalline L-Line Side Mount F85-1B64* balustrade system consisted of extruded aluminum support shoes with glass panels. The glass panels were 39-1/4 in long with an overall rail height (deck surface to top of top rail) of 52-1/2. Drawings are included in Section 11 to verify the overall dimensions and other pertinent information of the tested product, its components, and any constructed assemblies. Photographs are provided in Section 10.

<b>PRODUCT</b>	<i>Crystalline L-Line Side Mount F85-1B64</i>
<b>TYPE</b>	Aluminum and glass guardrail system
<b>OVERALL DIMENSIONS</b>	39-1/4 in wide by 52-1/2 in high
<b>GLASS PANELS</b>	7/8 in thick laminated glass constructed from two sheets of 3/8 in thick clear tempered glass and an 0.060 in thick interlayer
<b>GLASS CARRIAGE</b>	Two-piece extruded aluminum, secured in place with two 0.31 in O.D. set screws
<b>MOUNTING SHOE</b>	3 in wide by 5-1/4 in high H-shaped aluminum extrusion with a 4-1/4 in long mounting flange

**Fastening Schedule**

<b>GLASS PANEL TO MOUNTING SHOE</b>	Set onto glass carriages and secured in place with plastic wedge shims located on the interior side of the glass and flat plastic shims on the exterior side of the glass. A kerf-mounted rubber gasket was used on the exterior leg of the mounting shoe and a snap-fit aluminum cover with a kerf mounted rubber fin was used on the interior of the mounting shoe
<b>MOUNTING SHOE TO STEEL FIXTURE</b>	M10 hex head bolt, washer, and nut, located 5 in from each end and spaced 10 in on center

**TEST REPORT FOR ALUMINCO S.A.**

Report No.: I0411.03-119-19-R0

Date: 03/19/18

**SECTION 8  
TEST RESULTS**

**Key to Test Results Tables:**

Load Level: Target test load

Test Load: Actual applied load at the designated load level (target).

Elapsed Time (E.T.): The amount of time into the test with zero established at the beginning of the loading procedure.

**TEST NO. 1 - 12/12/17**

**DESIGN LOAD: 50 lb / 1 Square ft at Bottom of In-fill**

LOAD LEVEL	TEST LOAD (lb)	E.T. (min:sec)	MAX DISPLACEMENT (in)
Initial Load	10	00:00	0.00
2.0x Design Load	100	01:13	0.02
Initial Load	12	03:32	0.01
50% Recovery from 2.0 x Design Load			
4.0x Design Load	200	04:33	Achieved Load without Failure

**TEST NO. 2 - 01/25/18**

**DESIGN LOAD: 200 lb Concentrated Load at Top Corner of Glass Panel**

LOAD LEVEL	TEST LOAD (lb)	E.T. (min:sec)	MAX DISPLACEMENT (in)
Initial Load	38	00:00	0.00
2.0x Design Load	401	01:12	3.37
Initial Load	38	03:59	0.11
97% Recovery from 2.0 x Design Load			
4.0x Design Load	801	07:14	Achieved Load without Failure

**Test No. 3 - 12/12/17**

**DESIGN LOAD: 200 lb Concentrated Load at Top Corner of Glass Panel (Vertical)**

LOAD LEVEL	TEST LOAD (lb)	E.T. (min:sec)	MAX DISPLACEMENT (in)
Initial Load	40	00:00	0.00
2.0x Design Load	402	01:15	0.16
Initial Load	40	02:41	0.13
19% Recovery from 2.0 x Design Load			
4.0x Design Load	805	03:54	Achieved Load without Failure

**TEST REPORT FOR ALUMINCO S.A.**

Report No.: I0411.03-119-19-R0

Date: 03/19/18

**Test No. 4 - 01/26/18**

**DESIGN LOAD: 200 lb Concentrated Load at Top Corner of Glass Panel**

**(Applied from Exterior Side)**

LOAD LEVEL	TEST LOAD (lb)	E.T. (min:sec)	MAX DISPLACEMENT (in)
Initial Load	40	00:00	0.00
2.0x Design Load	402	01:05	3.12
Initial Load	40	04:38	0.25
92% Recovery from 2.0 x Design Load			
4.0x Design Load	807	06:50	Achieved Load without Failure

**SECTION 9**

**CONCLUSION**

The test results substantiate compliance with the design load and safety factor requirements of the referenced building codes for the 39-1/4 in wide by 52-1/2 in high balustrade (*Crystalline L-Line Side Mount F85-1B64*) reported herein. The system is limited to use in configurations consisting of three or more panels. Anchorage of support posts to the supporting structure is not included in the scope of this testing and would need to be evaluated separately.

## TEST REPORT FOR ALUMINCO S.A.

Report No.: I0411.03-119-19-R0

Date: 03/19/18

### SECTION 10

#### PHOTOGRAPHS



**Photo No. 1**  
**In-Fill Load Test at Bottom of Infill**



**Photo No. 2**  
**Concentrated Load at Top Corner of Glass Panel**



## TEST REPORT FOR ALUMINCO S.A.

Report No.: I0411.03-119-19-R0

Date: 03/19/18



Photo No. 3

Concentrated Load Test at Top Corner of Glass Panel (Applied from Exterior Side)



Photo No. 4

Concentrated Load Test at Top Corner of Glass Panel (Vertical)



Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
[www.intertek.com/building](http://www.intertek.com/building)

## TEST REPORT FOR ALUMINCO S.A.

Report No.: I0411.03-119-19-R0


Date: 03/19/18

### SECTION 11 DRAWINGS

The drawings for the *Crystalline L-Line Side Mount F85-1B64* glass balustrade system which follow have been reviewed by Intertek B&C and are representative of the project reported herein. Project construction was verified by Intertek B&C per the drawings included in this report. Any deviations are documented herein or on the drawings.

### F85-1B64

CRYSTALLINE L-LINE SIDE MOUNTED  
GLASS 10-4PVB-10MM

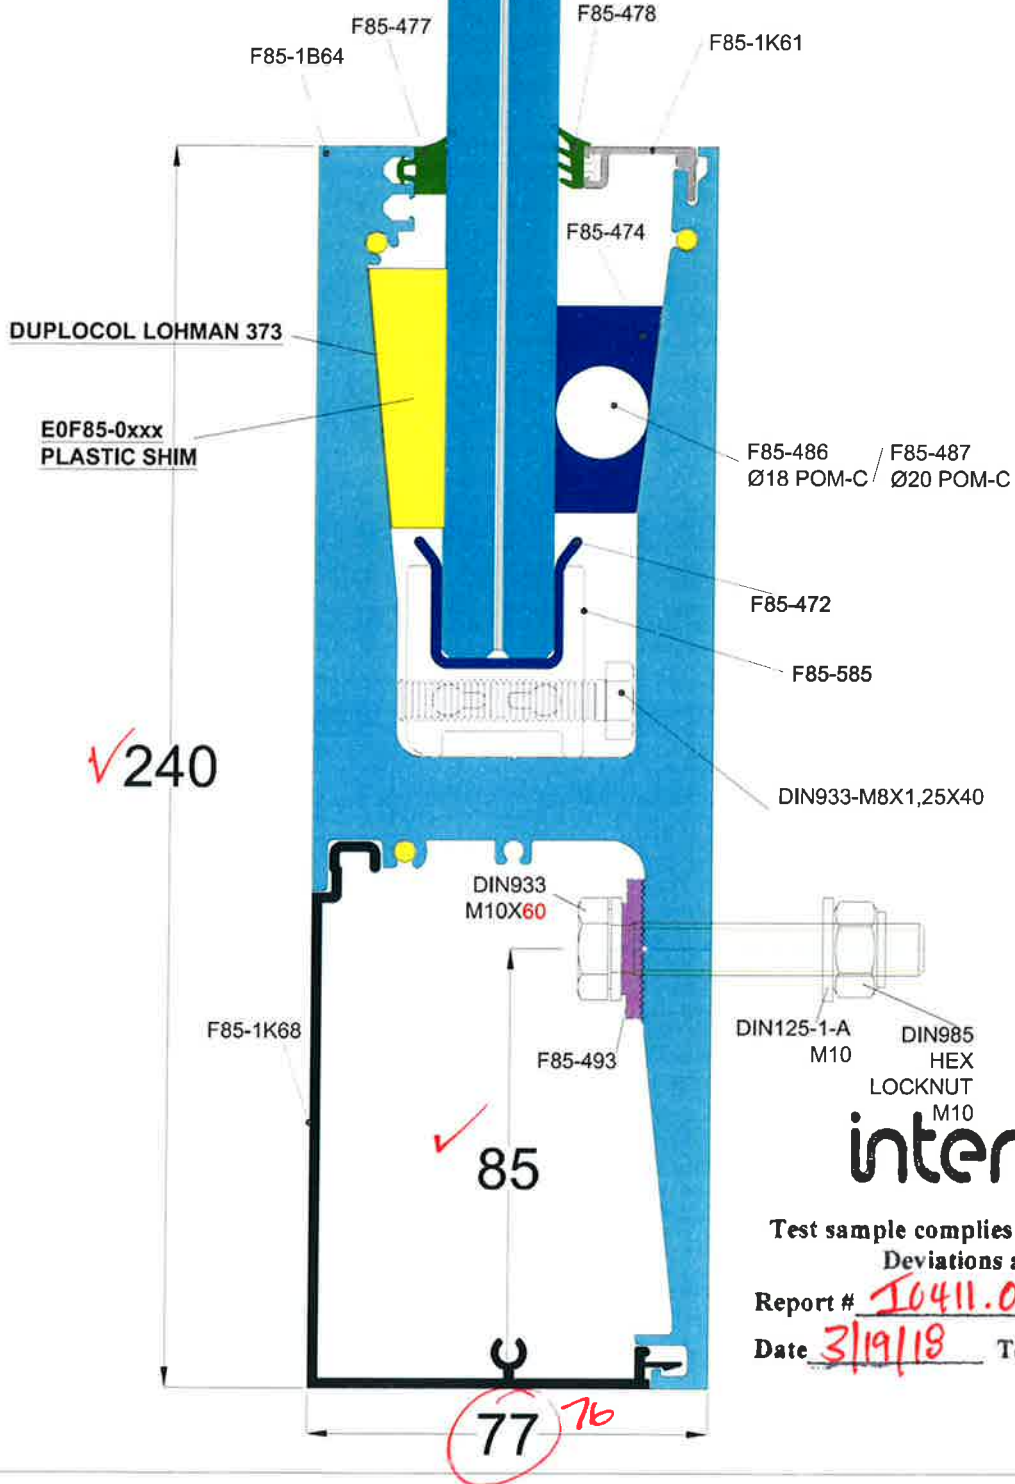

**intertek**

Test sample complies with these details.  
Deviations are noted.

Report # 10411.03

Date 3/19/18 Tech COE



Total Quality. Assured.

130 Derry Court  
York, Pennsylvania 17406

Telephone: 717-764-7700  
Facsimile: 717-764-4129  
[www.intertek.com/building](http://www.intertek.com/building)

**TEST REPORT FOR ALUMINCO S.A.**

Report No.: I0411.03-119-19-R0

Date: 03/19/18

**SECTION 12**

**REVISION LOG**

REVISION #	DATE	PAGES	REVISION
0	03/19/18	N/A	Original Report Issue